

LOCTITE® 5400™

November 2024

Product description

LOCTITE $^{\circledR}$ 5400 $^{\intercal}$ M provides the following product characteristics:

Technology	Acrylic			
Chemical type	Dimethacrylate ester			
Appearance (uncured)	Yellow to dark orange paste ^{LMS}			
Fluorescence	Positive under UV light ^{LMS}			
Components	One component - requires no mixing			
Viscosity	High, thixotropic			
Cure	Anaerobic			
Secondary cure	Activator			
Application	Thread sealing			
Strength	Medium			

LOCTITE[®] 5400TM is designed for the locking and sealing of metal threaded pipes and fittings. The product cures when confined in the absence of air between close fitting metal surfaces and prevents loosening and leakage from shock and vibration. The thixotropic nature of LOCTITE[®] 5400^{TM} reduces the migration of liquid product after application to the substrate.

Typical properties of uncured material

Specific gravity @ 25°C 1.1

Flash point - see SDS


Viscosity, Cone & Plate, mPa·s (cP):

Cone 35/2°Ti @ shear rate 20 s⁻¹ 5,000 to 20,000^{LMS}

Typical curing performance


Cure speed vs. substrate

The rate of cure will depend on the substrate used. The graph below shows the breakaway strength developed with time on M10 steel nuts and bolts compared to different materials and tested according to ISO 10964.

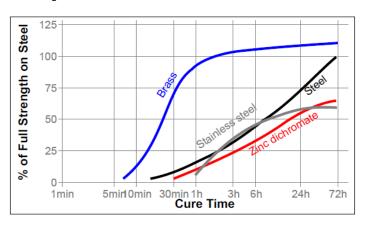


Cure speed vs. bond gap

The rate of cure will depend on the bondline gap. Gaps in threaded fasteners depends on thread type, quality and size. The following graph shows shear strength developed with time on steel pins and collars at different controlled gaps and tested according to ISO 10123.

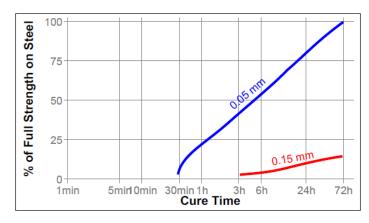

Cure speed vs. temperature


The rate of cure will depend on the temperature. The graph below shows the breakaway strength developed with time at different temperatures on M10 steel nuts and bolts and tested according to ISO 10964.

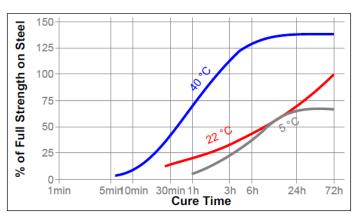



Cure speed vs. activator

Where cure speed is unacceptably long, or large gaps are present, applying activator to the surface will improve cure speed. The graph below shows the breakaway strength developed with time on M10 zinc dichromate steel nuts and bolts using Activator 7471™ and 7649™ and tested according to ISO 10964.

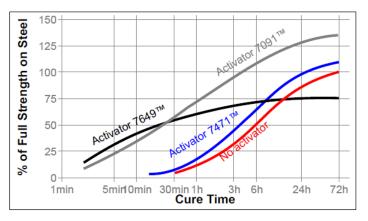

Typical performance of cured material Adhesive properties

Cured for 24 hours @ 22 °C

Breakaway torque, ISO 10964, unseated:

M 10 X 1.5 black oxide bolts and steel nuts	N·m (lb·in)	19 (170)
M 10 brass nuts and bolts	N·m (lb·in)	28 (250)
M 10 zinc dichromate nuts and bolts	N·m (lb·in)	15 (130)
M 10 stainless steel nuts and bolts	N·m (lb·in)	15 (130)
Prevail torque @ 180°, ISO 10964, unseated:		
M 10 X 1.5 black oxide bolts and steel nuts	N·m (lb·in)	3 (25)
M 10 brass nuts and bolts	N·m (lb·in)	4 (35)
M 10 zinc dichromate nuts and bolts	N·m (lb·in)	4 (35)
M 10 stainless steel nuts and bolts	N·m (lb·in)	3 (25)

Breakloose torque, ISO 10964, pre-torqued to 5 N·m:

M 10 black oxide bolts and steel nuts	N·m (lb·in)	(220)
Prevail torque @ 180°, ISO 10964, pre-torqued	to 5 N·m:	
M 10 black oxide bolts and steel nuts	N·m	4

Со

M 10 black oxide boits and steel nuts	(lb·in)	(35)
ompressive shear strength, ISO 10123:		

5^{LMS}

(725)

N/mm²

(psi)

Steel pins and collars (degreased)

After 7 days @ 22 °C Breakloose torque, ISO 10964, pre-torqued to 5 N·m:

N·m 16 M 10 stainless steel nuts and bolts (lb·in) (140)

Prevail torque @ 180°, ISO 10964, pre-torqued to 5 N·m:

M 10 stainless steel nuts and bolts (lb·in) (20)


Typical environmental resistance

Cured for 1 week @ 22 °C

Breakloose torque, ISO 10964, pre-torqued to 5 N·m: M10 zinc phosphate steel nuts and bolts


Hot strength

Tested at temperature

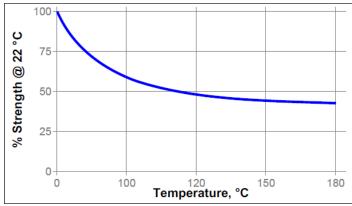

Heat aging

Aged at temperature indicated and tested @ 22 °C.

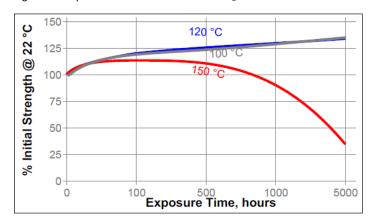

Chemical/solvent resistance

Aged under conditions indicated and tested @ 22°C.

	% of initial strength				
°C	100 h	500 h	1000 h	5000 h	
125	105	100	95	75	
22	105	110	115	80	
22	95	105	105	100	
22	95	95	100	90	
22	90	70	75	115	
87	105	110	105	105	
22	90	95	90	80	
22	95	100	105	110	
	125 22 22 22 22 22 22 87 22	°C 100 h 125 105 22 105 22 95 22 95 22 90 87 105 22 90	°C 100 h 500 h 125 105 100 22 105 110 22 95 105 22 95 95 22 90 70 87 105 110 22 90 95	°C 100 h 500 h 1000 h 125 105 100 95 22 105 110 115 22 95 105 105 22 95 95 100 22 90 70 75 87 105 110 105 22 90 95 90	



Breakloose torque, ISO 10964, pre-torqued to 5 N·m: M 10 stainless steel nuts and bolts

		% of initial strength			
Environment	°C	100 h	500 H	1000 h	5000 h
Sodium hydroxide, 20%	22	90	100	95	100
Phosphoric acid, 10%	22	110	95	80	105
DEF (AdBlue®)	22	95	100	100	90

GENERAL INFORMATION

This product is not recommended for use in pure oxygen and/or oxygen rich systems and should not be selected as a sealant for chlorine or other strong oxidizing materials.

For safe handling information on this product, consult the Safety Data Sheet (SDS).

Where aqueous washing systems are used to clean the surfaces before bonding, it is important to check for compatibility of the washing solution with the adhesive. In some cases these aqueous washes can affect the cure and performance of the adhesive.

This product is not normally recommended for use on plastics (particularly thermoplastic materials where stress cracking of the plastic could result). Users are recommended to confirm compatibility of the product with such substrates.

Directions for use For assembly

- 1. For best results, clean all surfaces (external and internal) with a ${\sf LOCTITE}^{\it B}$ cleaning solvent and allow to dry.
- 2. If the material is an inactive metal or the cure speed is too slow, spray with LOCTITE® SF 7471™ or LOCTITE® SF 7649™ and allow to dry.
- 3. Apply a 360° bead of product to the leading threads of the male fitting, leaving the first thread free. Force the material into the threads to thoroughly fill the voids. For bigger threads and voids, adjust product amount accordingly and apply a 360° bead of product on the female threads also.
- 4. Using compliant practices, assemble and wrench tighten fittings in accordance with manufacturers recommendations.
- 5. Properly tightened fittings will seal instantly to moderate pressures. For maximum pressure resistance and solvent resistance allow the product to cure a minimum of 24 hours.
- Remove any excess uncured product with cleaner LOCTITE[®] SF 7063™ (or similar grade), if required.

For disassembly

- 1. Remove with standard hand tools.
- 2. Where hand tools do not work because of excessive engagement length or large diameters (over 1"), apply localized heat to approximately 250°C. Disassemble while hot.

For cleanup

 Cured product can be removed with a combination of soaking in a LOCTITE[®] solvent and mechanical abrasion such as a wire brush.

Loctite material specification^{LMS}

LMS dated April 11, 2011. Test reports for each batch are available for the indicated properties. LMS test reports include selected QC test parameters considered appropriate to specifications for customer use. Additionally, comprehensive controls are in place to assure product quality and consistency. Special customer specification requirements may be coordinated through Henkel Quality.

Storage

Store product in the unopened container in a dry location. Storage information may be indicated on the product container labeling.

Optimal storage: 8° C to 21° C. Storage below 8° C or greater than 28° C can adversely affect product properties.

Material removed from containers may be contaminated during use. Do not return product to the original container. Henkel cannot assume responsibility for product which has been contaminated or stored under conditions other than those previously indicated. If additional information is required, please contact your local Henkel representative.

Product specification

The technical data contained herein are intended as reference only and are not considered specifications for the product. Product specifications are located on the Certificate of Analysis or please contact Henkel representative.

Approval and certificate

Please contact Henkel representative for related approval or certificate of this product

Data ranges

The data contained herein may be reported as a typical value. Values are based on actual test data and are verified on a periodic basis.

Temperature/Humidity Ranges: 23° C / 50% RH = $23\pm2^{\circ}$ C / $50\pm5\%$ RH

Conversions

(°C x 1.8) + 32 = °F kV/mm x 25.4 = V/mil mm / 25.4 = inches μ m / 25.4 = mil N x 0.225 = lb N/mm x 5.71 = lb/in N/mm² x 145 = psi MPa x 145 = psi N·m x 8.851 = lb·in N·m x 0.738 = lb·ft N·mm x 0.142 = oz·in mPa·s = cP



Disclaimer

The information provided in this Technical data sheet (TDS) including the recommendations for use and application of the product are based on our knowledge and experience of the product as at the date of this TDS. The product can have a variety of different applications as well as differing application and working conditions in your environment that are beyond our control. Henkel is, therefore, not liable for the suitability of our product for the production processes and conditions in respect of which you use them, as well as the intended applications and results. We strongly recommend that you carry out your own prior trials to confirm such suitability of our product. Any liability in respect of the information in Technical data sheet or any other written or recommendation(s) regarding the concerned product is excluded, except if otherwise explicitly agreed and except in relation to death or personal injury caused by our negligence and any liability under any applicable mandatory product liability law.

In case products are delivered by Henkel Belgium NV, Henkel Electronic Materials NV, Henkel Nederland BV, Henkel Technologies France SAS and Henkel France SA please additionally note the following:

In case Henkel would be nevertheless held liable, on whatever legal ground, Henkel's liability will in no event exceed the amount of the concerned delivery.

In case products are delivered by Henkel Colombiana, S.A.S. the following disclaimer is applicable:

The information provided in this Technical Data Sheet (TDS) including the recommendations for use and application of the product are based on our knowledge and experience of the product as at the date of this TDS. Henkel is, therefore, not liable for the suitability of our product for the production processes and conditions in respect of which you use them, as well as the intended applications and results. We strongly recommend that you carry out your own prior trials to confirm such suitability of our product. Any liability in respect of the information in the Technical Data Sheet or any other written or oral recommendation(s) regarding the concerned product is excluded, except if otherwise explicitly agreed and except in relation to death or personal injury caused by our negligence and any liability under any applicable mandatory product liability law.

In case products are delivered by Henkel Corporation, or Henkel Canada Corporation, the following disclaimer is applicable:

The data contained herein are furnished for information only and are believed to be reliable. We cannot assume responsibility for the results obtained by others over whose methods we have no control. It is the user's responsibility to determine suitability for the user's purpose of any production methods mentioned herein and to adopt such precautions as may be advisable for the protection of property and of persons against any hazards that may be involved in the handling and use thereof. In light of the foregoing, Henkel Corporation specifically disclaims all warranties expressed or implied, including warranties of merchantability or fitness for a particular purpose, arising from sale or use of Henkel Corporation's products. Henkel Corporation specifically disclaims any liability for consequential or incidental damages of any kind, including lost profits. The discussion herein of various processes or compositions is not to be interpreted as representation that they are free from domination of patents owned by others or as a license under any Henkel Corporation patents that may cover such processes or compositions. We recommend that each prospective user test his proposed application before repetitive use, using this data as a guide. This product may be covered by one or more United States or foreign patents or patent applications.

Trademark usage

Except as otherwise noted, all trademarks in this document are trademarks of Henkel Corporation in the U.S. and elsewhere. ® denotes a trademark registered in the U.S. Patent and Trademark Office.

Reference 0.2

For the most direct access to local sales and technical support visit: www.next.henkel-adhesives.com/